



## VERSITRIM 200 GOLD COPING TAPERED VERSION - 4'-0" O.C.

 
INSTALLATION INSTRUCTIONS

4'-0" O.C.




1) Installing contractor shall check as-built conditions, including nailer attachment, and verify the manufacturer's coping details for accuracy to fit the wall assembly prior to fabrication.

2) Fasteners must be corrosion resistant and rated for a minimum 250# pullout force for the substrate that is being used.



If using an EIFS system, fasten through face w/ fastener of proper length to penetrate through EIFS and attach into structural component

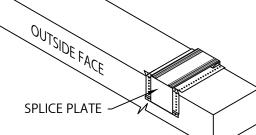

STEP 8 - SPLICE PLATES PLACE SPLICE PLATE ONTO ANCHOR CLIPS AT SPLICE JOINTS, 12'-0" O.C. NOTE: REMOVE RELEASE PAPER FROM SEALANT STRIPS. STEP 7 - ANCHOR CLIPS

OUTSIDE FACE

LOCATE OVER MEMBRANE AND FASTEN GALVANIZED ANCHOR CLIPS TO WALL AT 4'-0" CENTER WITH PROVIDED FASTENERS AS SHOWN IN DETAIL A.

ISIDE FACE

STEP 9 - COPING HOOK OUTSIDE FACE OF COPING OVER THE ANCHOR CLIPS AND ROTATE INTO PLACE. ENGAGE REAR LEG ONTO ANCHOR CLIPS BY PRESSING DOWNWARD UNTIL SNAP LOCK OCCURS.

3/8" SPACE

CONTINUE INSTALLING COPING WITH A 3/8" SPACE AT SPLICE JOINTS TO ALLOW FOR THERMAL EXPANSION. FIELD CUT WHERE NECESSARY USING FINE TOOTH HACKSAW OR SNIPS.

**STEP 10 - COMPLETION** 

NOTE: REMOVE PROTECTIVE FILM IMMEDIATELY.



