


# SecurEdge 300 Coping & SecurEdge 300 Plus Coping Installation Guide

ANSI/SPRI/FM4435/ES-1 TESTED

PO BOX 70000, CARLISLE, PA 17013 USA 800-479-6832 WWW.CARLISLESYNTEC.COM

DATE: 02/19/24 | DRN BY: SJ | CKD BY: MM | DWG #: 15111-39470 | REV: B

### STRAIGHT LENGTH CLIP SPACING 36" O.C. FOR ALL SIZES

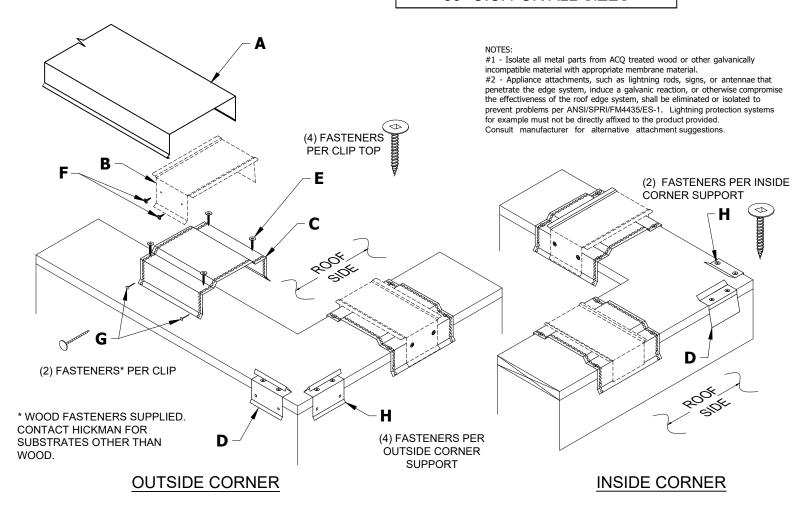

NOTE: ALL MITERS, END CONDITIONS, AND ACCESSORY CONDITIONS SHOULD BE INSTALLED PRIOR TO STRAIGHT SECTIONS

### A. Formed Coping Cap

12'-0" Lengths

### **B. 6" Wide Concealed Joint Splice**

One (1) at Each Clip Location

### C. 12" Wide Galv. Steel Clips

Spaced @ 36" O.C.

### **D. Corner Supports (Inside & Outside)**

Used to Support Outside and Inside Miters

#### E. Top Clip Fasteners

Four (4) Fasteners Per Clip (Included & Required)

### F. Splice Fasteners

Two (2) Screws Per Splice (Included & Required)

#### **G. Face Clip Fasteners\***

Two (2) Fasteners Per Clip (Included & Required)

### **H. Corner Support Fasteners**


Two (2) Fasteners Per Corner Support (Included & Required)

Two (2) Nails Per Outside Corner Support (Included & Required)


# SecurEdge 300 Coping & SecurEdge 300 Plus Coping Reference Guide

1. Sta	andard Installation Steps	Page 4
1.1.	Corner Supports	Page 4
1.2.	Coping Clip	Page 4
1.3.	Coping Splice	Page 5
1.4.	Coping Miter	Page 5
1.5.	Coping End Condition	Page 6
1.6.	Coping Straight Section	Page 6
2. Ac	cessory Condition Guide	Page 7
2.1.	Inline Miter Conditions	Page 8
2.2.	Pier Miter Conditions	Page 9
2.3.	Tee Miter Conditions	Page 10
2.4.	Ridge Miter Conditions	Page 11
2.5.	Valley Miter Conditions	Page 11
2.6.	Horizontal Zee Miter Conditions	Page 12
2.7.	Vertical Zee Miter Conditions	Page 13
2.8.	Vaulted Conditions	Page 14
2.9.	Radius Conditions	Page 15


STEP 1: BEGIN COPING INSTALLATION AT CORNER LOCATIONS AS SHOWN IN PICTURE BELOW BY INSTALLING CORNER SUPPORTS FLUSH AGAINST THE SUBSTRATE THEN USING THE FASTENERS PROVIDED FOR SECUREMENT.

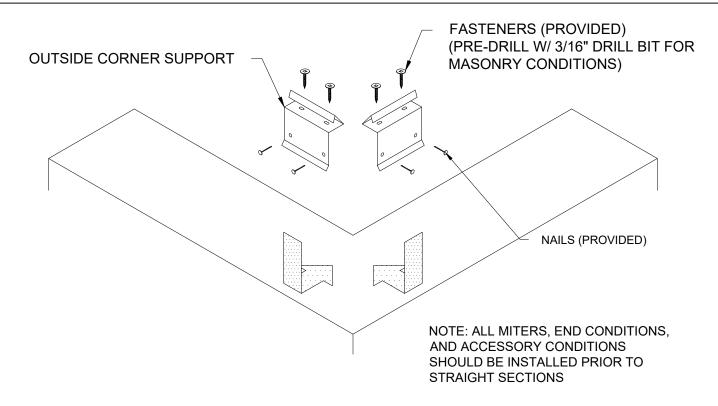


STEP 2: ALIGN CENTER OF EACH CLIP FROM THE CORNER SUCH THAT THE MITER LEG SITS HALF-WAY OVER EACH CLIP AS SEEN IN STEPS 3 & 4 (PAGE 4)

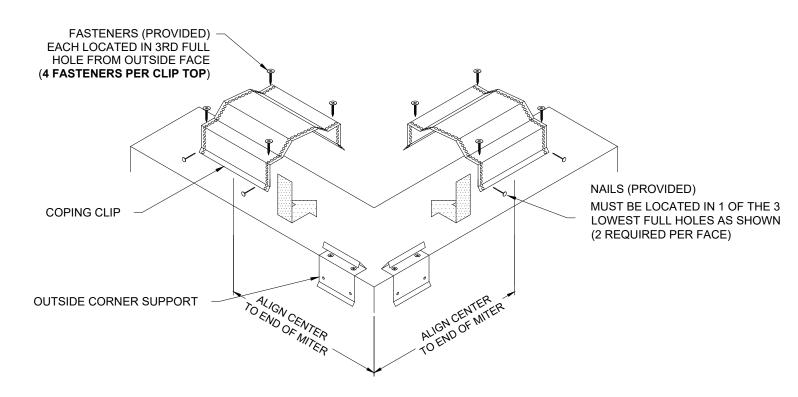


STEP 3: LOCATE SPLICES AND SEPARATE FROM THE SET. ALIGN FACE KICKOUTS OF THE SPLICE AND CLIP. SECURE EACH SPLICE USING THE FASTENERS PROVIDED AT THE PRE-PUNCHED HOLES IN THE FACE OF THE SPLICE.

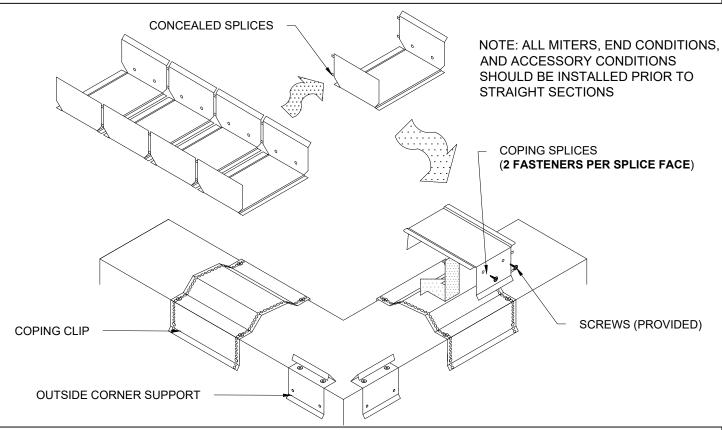


STEP 4: LOCATE MITER AND PLACE ONE LEG OVER THE CORNER SUPPORT AND CLIP, ROTATE BACKWARD AND PRESS DOWNWARD ON CAP TO ENGAGE ONTO CLIP, THEN REPEAT ON ADJACENT LEG OF MITER. (INSIDE MITER IS INSTALLED IN THE SAME MANNER USING INSIDE CORNER SUPPORTS).

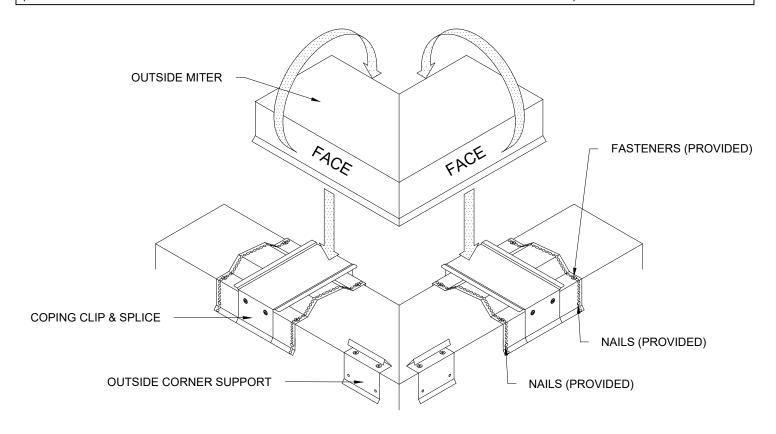

STEP 5: PLACE CLIPS AT END LOCATIONS SHOWN BELOW AND LOCATE END CAPS/END TERMS AND HOOK ON FRONT OF CLIP, ROTATE BACKWARD AND PRESS DOWNWARD TO ENGAGE ONTO CLIP. \*SECURE ENDCAP TO CLIP USING POP-RIVET OR SCREW (BY INSTALLER) TO PREVENT LATERAL MOVEMENT.

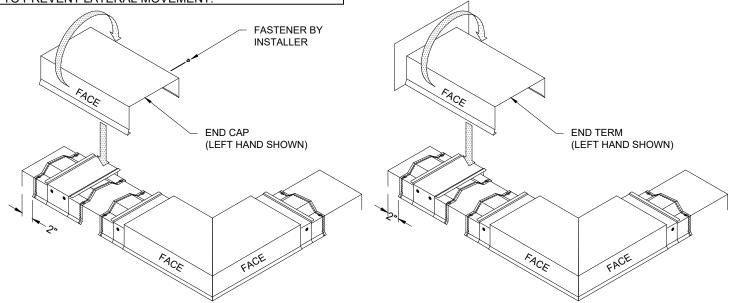


NOTE: ALL MITERS, END CONDITIONS, AND ACCESSORY CONDITIONS SHOULD BE INSTALLED PRIOR TO STRAIGHT SECTIONS

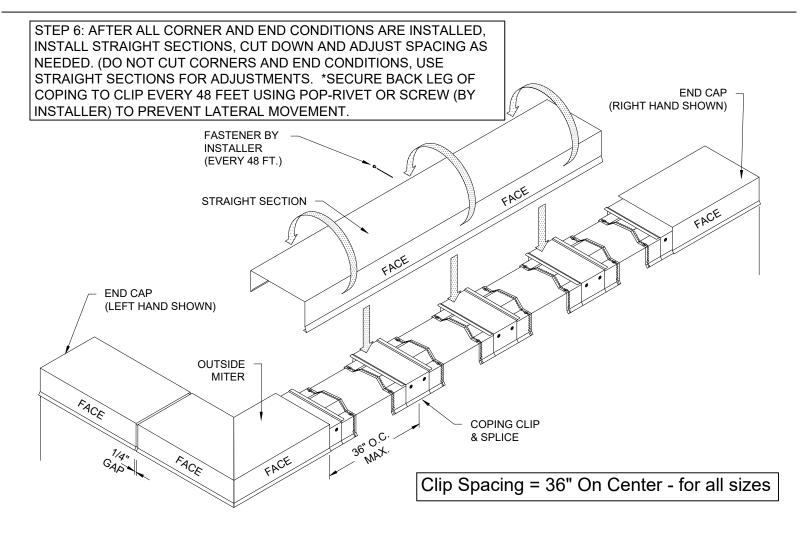


## SecurEdge 300 Coping & SecurEdge 300 Plus Coping Accessory Conditions Reference

- Inline Miter Conditions (Page 8)
- Pier Miter Conditions (Page 9)
- Tee Miter Conditions (Page 10)
- Ridge Miter Conditions (Page 11)
- Valley Miter Conditions (Page 11)
- Horizontal Zee Miter Conditions (Page 12)
- Vertical Zee Miter Conditions (Page 13)
- Vaulted Conditions (Page 14)
- Radius Conditions (Page 15)


### **INLINE MITER CONDITIONS**

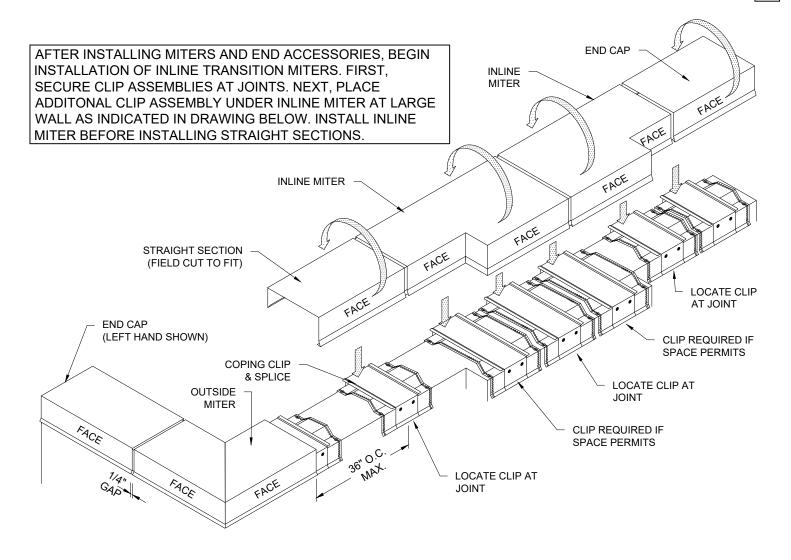


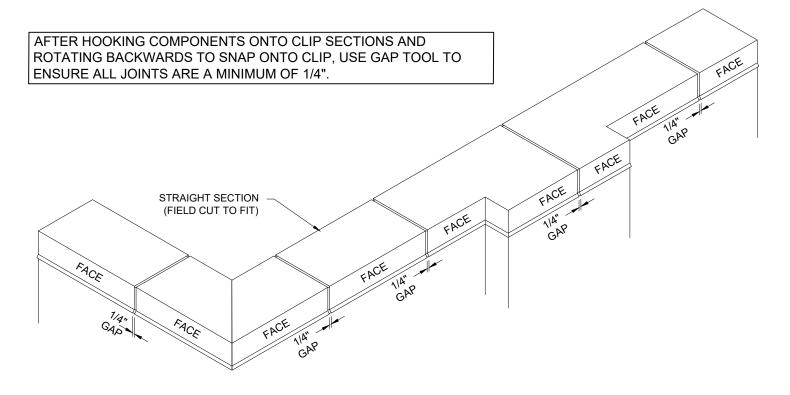

### PIER MITER CONDITIONS


LOCATE OUTSIDE CORNER SUPPORT AT OUTSIDE PIER LOCATION FIRST. PROCEED WITH LOCATING CENTER OF CLIP/SPLICES AT END OF EACH MITER LEG. HOOK ONTO FRONT OF CORNER SUPPORT AND COPING CLIP, ROTATE BACKWARD ONTO CLIP AND PUSH DOWNWARD TO ENGAGE CAP ONTO CLIP, THEN PROCEED WITH ADJACENT LEG.

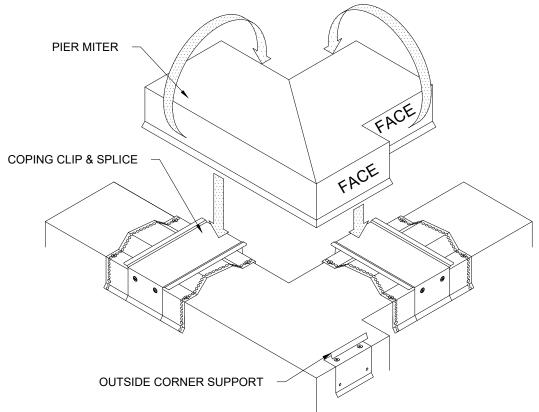


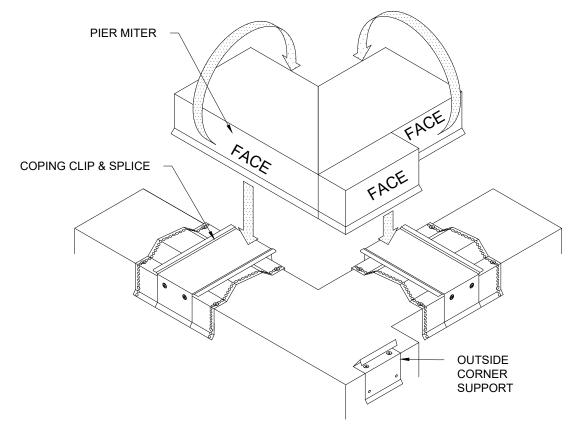

### **TEE MITER CONDITIONS**


LOCATE CENTER OF CLIP/SPLICES AT END OF EACH MITER LEG. HOOK ONTO FRONT OF COPING CLIPS WHICH ARE IN-LINE FIRST, ROTATE BACKWARD ONTO CLIP AND PUSH DOWNWARD TO ENGAGE CAP ONTO CLIP, THEN PROCEED WITH ADJACENT LEG.

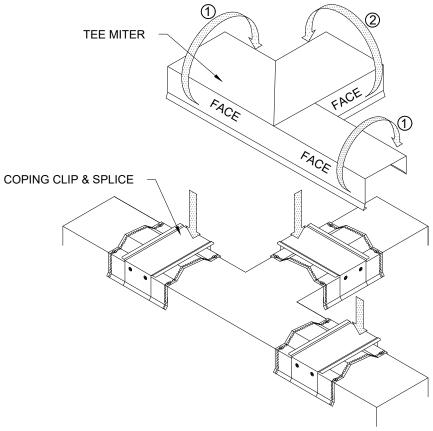

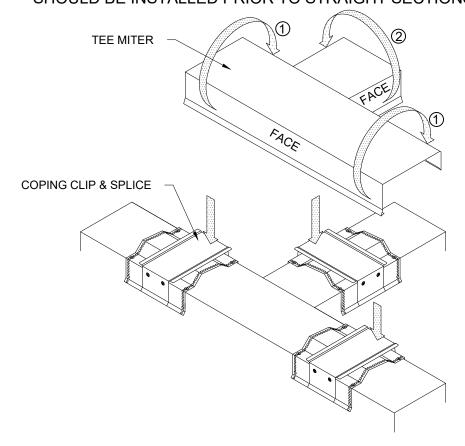

### RIDGE MITER CONDITIONS & VALLEY MITER CONDITIONS


START BY INSTALLING END CONDITION ACCESSORIES (ENDCAPS AND ENDTERMS), CORNER MITERS AND VALLEY MITERS (RIDGE MITER WILL BE INSTALLED LAST). FOR VALLEY MITERS, LOCATE CLIPS AT JOINTS (NO SPLICE REQUIRED FOR SLOPED WALLS AS SHOWN BELOW). LOCATE RIDGE MITER NEXT, BE SURE TO LOCATE CENTER OF CLIPS TO ALIGN WITH END OF RIDGE MITER (NO SPLICE REQUIRED FOR SLOPED WALLS AS SHOWN BELOW). ADJUST OFFSET CAP LENGTHS (DO NOT CUT FROM OFFSET TAB SIDE) TO FIT IN BETWEEN MITER AND END CONDITIONS ON SLOPED WALLS. INSTALL RIDGE MITER AFTER ALL OTHER PARTS HAVE BEEN INSTALLED.

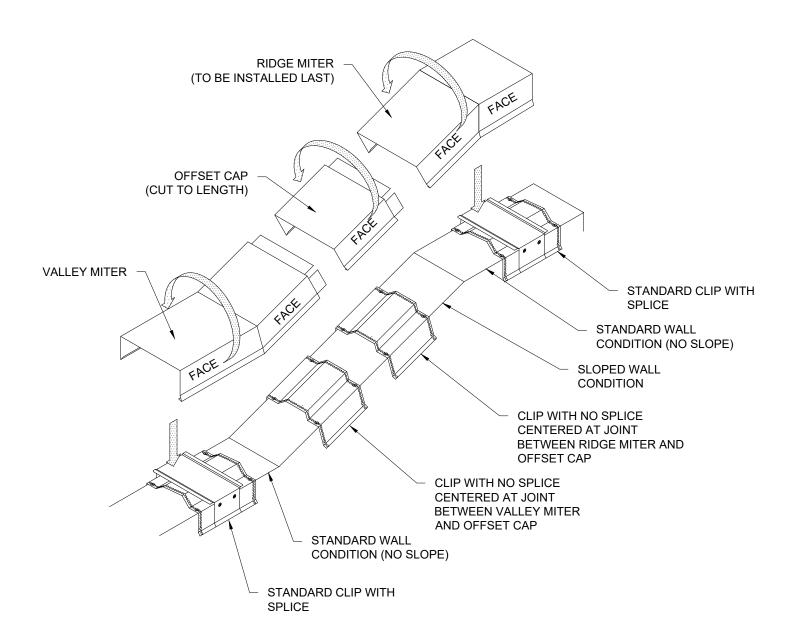

Clip Spacing = 36" On Center - for all sizes


NOTE: ALL MITERS, END CONDITIONS, AND ACCESSORY CONDITIONS (OTHER THAN RIDGE MITER) SHOULD BE INSTALLED PRIOR TO STRAIGHT SECTIONS

LOCATE CORNER SUPPORTS AT OUTSIDE AND INSIDE CORNER LOCATIONS FIRST. NEXT, LOCATE CENTER OF CLIP/SPLICES AT END OF EACH MITER LEG. HOOK ONTO FRONT OF CORNER SUPPORT AND COPING CLIP, ROTATE BACKWARD ONTO CLIP AND PUSH DOWNWARD TO ENGAGE CAP ONTO CLIP, THEN PROCEED WITH ADJACENT LEG.

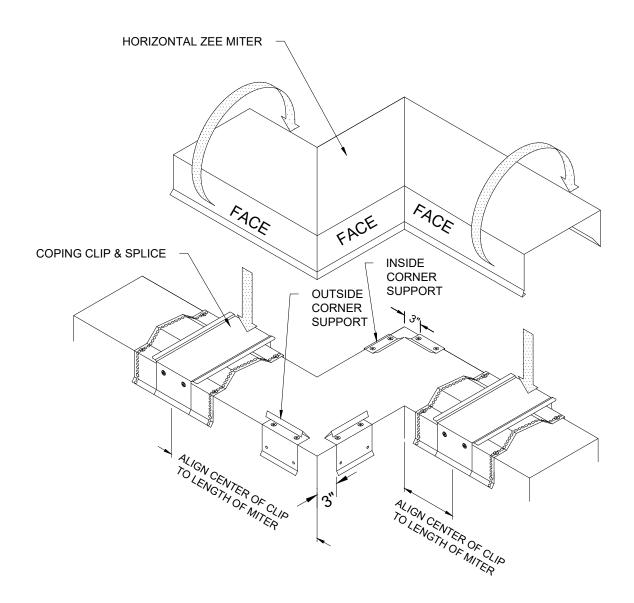


### **VERTICAL ZEE MITER CONDITIONS**

LOCATE CENTER OF CLIP/SPLICES AT END OF EACH MITER LEG. HOOK ONTO FRONT OF COPING CLIP, ROTATE BACKWARD ONTO CLIP AND PUSH DOWNWARD TO ENGAGE CAP ONTO CLIP, THEN PROCEED WITH ADJACENT LEG.

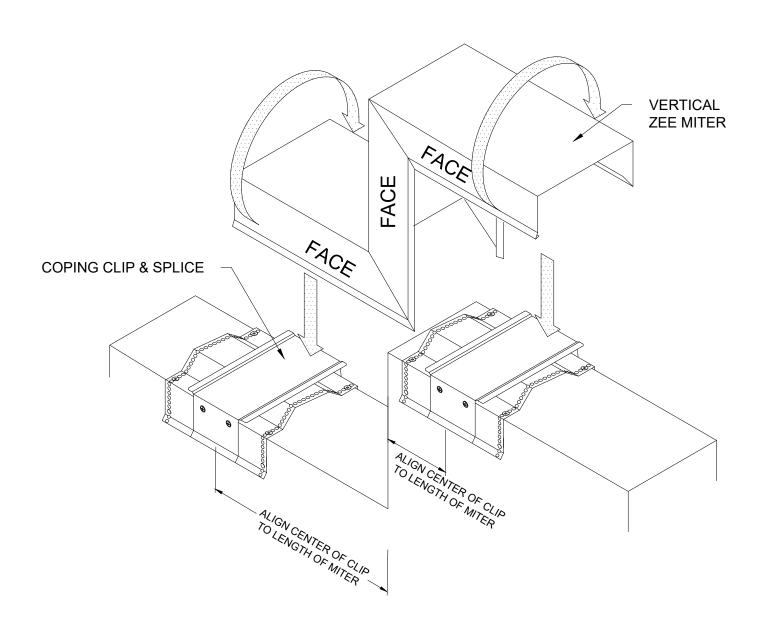


LOCATE CORNER SUPPORTS AT OUTSIDE AND INSIDE CORNER LOCATIONS FIRST. NEXT LOCATE CLIPS AT END LOCATIONS AS SHOWN IN STEP 5 (PAGE 5). PROCEED WITH LOCATING CENTER OF CLIP/SPLICES AT END OF EACH MITER LEG. HOOK ONTO FRONT OF CORNER SUPPORT AND COPING CLIP, ROTATE BACKWARD ONTO CLIP AND PUSH DOWNWARD TO ENGAGE CAP ONTO CLIP THEN PROCEED WITH ADJACENT LEG. FINALLY LOCATE ADDITIONAL CLIPS SPACED AT 30" ON CENTER FOR RADIUS SECTION (CUT AS NEEDED) SECURE CAP ONTO CLIPS BY PUSHING HOOKING AND ROTATING CAPS TO SECURE ONTO CLIPS.

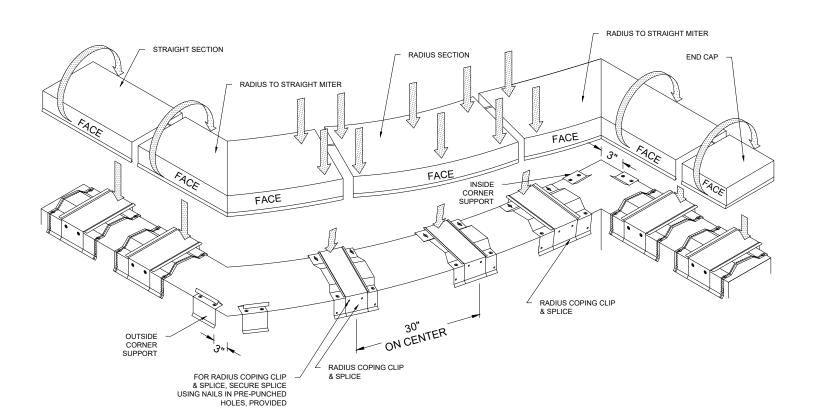

Radius Clip Spacing = 30" On Center - for all sizes

### **VAULT CONDITIONS**

LOCATE CENTER OF CLIPS AT END OF MITER LEGS FIRST. PROCEED WITH INSTALLING CLIPS PER STEP 5 (PAGE 5), HOOK CAP ROTATE BACKWARD ONTO CLIP AND PUSH DOWNWARD TO ENGAGE CAP ONTO CLIP. FINALLY LOCATE VAULT CLIPS AT 30" ON CENTER (NO SPLICES REQUIRED). SECURE CAP ONTO CLIPS BY HOOKING AND ROTATING CAPS TO SECURE ONTO CLIPS. ADJUST VAULT CAP LENGTHS (DO NOT CUT FROM OFFSET TAB SIDE) TO FIT IN BETWEEN MITER AND END CONDITIONS ON SLOPED WALLS. USING SPACING CHART FOR CLIPS AS SHOWN BELOW.

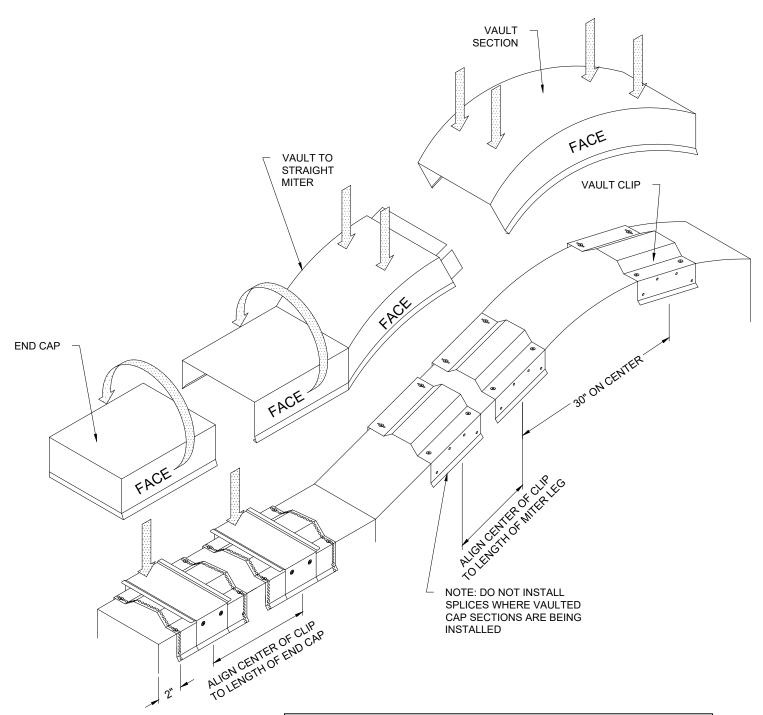

Vault Clip Spacing = 30" On Center - for all sizes

NOTES	

Disclaimer: Manufacturer has performed testing in accordance with ANSI/SPRI/FM4435/ES-1

any deviation from the system as intended may void warranty claims. The systems are designed independent from any other building material/product if another material/product is used in conjunction with this product it will nullify the warranty.

Please contact manufacturer for assistance.



## End of Installation Guide SecurEdge 300 Coping & SecurEdge 300 Plus Coping

Please contact Manufacturer for assistance.