
REATIVE DESIGN SHADOWLINE FASCIA FULLY ADHERED OR MECHANICALLY ATTACHED SINGLE-PLY VERSION


INSTALLATION INSTRUCTIONS

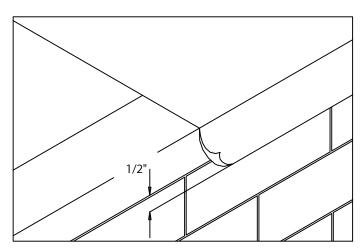

1. Roof Membrane

Position membrane over the roof edge and down outside face of wall, covering treated wood nailer(s) completely. Allow 1/2" excess membrane.


IMPORTANT! Outside edge of treated wood nailer(s) (min. 2" X 4") shall be aligned flush with or extend slightly past outermost edge of wall.

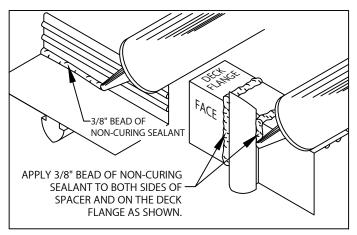

3. Anchor Bar Splice Plates


Apply non-curing sealant to each plate as shown and described in STEP 2. Ensure the sealant is placed into the grooves along the spacer.

CAUTION! Installers shall wear protective eye wear to prevent injury. Do not over-drive fasters, as stripping can occur at high driver torque. Recommended driving tool: 600-800 rpm electric drill equipped with depth-sensing nose-piece to prevent driving and stripout. Do not use impact type tool.

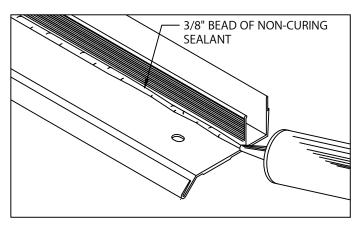

2. Miter & Scupper Anchor Bar (Preparation)

Lay miters and scuppers on deck with outside face down. Be sure aluminum anchor bar is clean and free of dirt or dust. Apply a heavy 3/8" bead of non-curing sealant to the right angle intersection of the deck flange and back of anchor-bar as shown. Application of sealant is required along the full length of each miter anchor-bar.

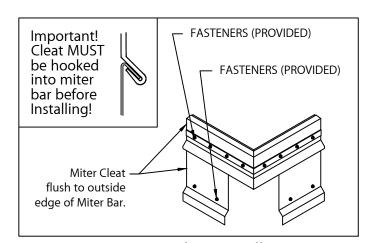

4. Miter Bar & Miter Cleat Installation

Hook miter cleat pieces to the miter bar. Flush ends of miter cleat piece and miter bar. Fold roofing membrane at corners and install miter assembly with one anchor bar spice plate under each end of miter bar, anchor bar splice plate must be inserted into the grooves of the splice plates and snug to the ends of the bar. Fasteners and drive bits provided by manufacturer. Fasten the miter bar and miter cleat using provided fasteners. Next locate and install scuppers with sealant, fasteners and anchor bar splice plates.



Phone: 828-676-1700

DATE: 01/31/22

SHT.# 1 OF 2

www.hickmanedgesystems.com


DRN BY: MLM CKD BY: MM

DWG# 64110-37757

CREATIVE DESIGN SHADOWLINE FASCIA


FULLY ADHERED OR MECHANICALLY ATTACHED SINGLE-PLY VERSION

INSTALLATION INSTRUCTIONS

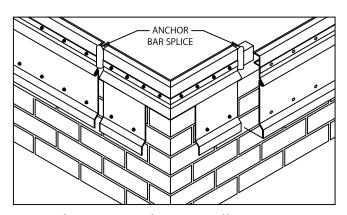


5. Anchor Bar & Cleat Installation

Hook anchor cleat to anchor bar as shown in step 4. Position 12'-0" anchor bar/cleat sections with applied non-curing sealant as shown in step 2 overlapping anchor bar splice plate. Allow 3/8" space between anchor bars. Install anchor bar splice plate at other end of bar/cleat section. Fasten anchor bar 12" O.C. through slotted holes using provided fasteners. Fasten anchor cleat 24" O.C. through slotted holes using provided fasteners. The anchor bars must insert into the grooves of the anchor bar splice plates. Field cut sections as necessary.

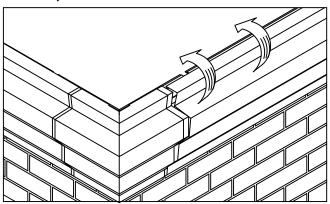

7. Fascia Covers


Install 12'-0" fascia cover sections. Allow a 3/8" gap between fascia cover sections. Insert one splice plate under far end of each fascia cover section. Install cover by hooking lower edge of cover onto anchor cleat and rotating cover up and over anchor bar until engaged along entire length of cover section. Continue to install cover sections in this manner, field cutting where necessary using a fine tooth hacksaw.

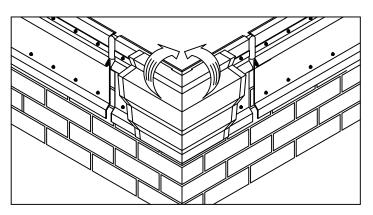

6. Fascia Miter Covers

Install miter covers first. Insert one splice plate under each end of miter cover. Install miter covers by engaging miter cover onto anchor cleat and rotating miter cover up and over anchor bar miter until engaged along entire length of the anchor bar.

IMPORTANT! Be sure to remove protective plastic film prior to installing each fascia section.

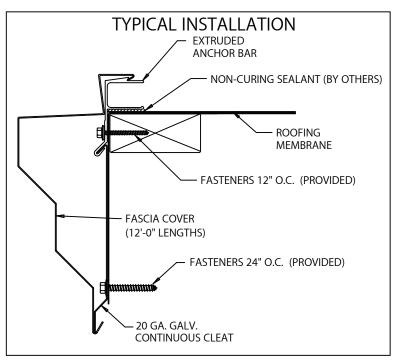



Phone: 828-676-1700

DATE: 01/31/22

SHT.#_2 OF _2

www.hickmanedgesystems.com

DRN BY: MLM
CKD BY: MM

DWG# 64110-37757